



*Orkney Surveying Services*

**Billy Groundwater** AssocRICS  
Quantity Surveyor and Project Manager

Castlehowe, Sower Rd, Orphir, Orkney, KW17 2RE  
Mob: 07585447329 Tel: 01856811765

Web: [www.orkneysurveying.co.uk](http://www.orkneysurveying.co.uk)  
Email: [billy@orkneysurveying.co.uk](mailto:billy@orkneysurveying.co.uk)

# Home Report

**Sharlea  
Galaha  
Orphir  
Orkney  
KW17 2RB**



*Orkney Surveying Services*

**Billy Groundwater** AssocRICS  
Quantity Surveyor and Project Manager

Castlehowe, Sower Rd, Orphir, Orkney, KW17 2RE  
Mob: 07585447329 Tel: 01856811765

Web: [www.orkneysurveying.co.uk](http://www.orkneysurveying.co.uk)  
Email: [billy@orkneysurveying.co.uk](mailto:billy@orkneysurveying.co.uk)

Our services include:

Quantity Surveying  
Project Management  
Property Valuations  
Deed Plans

Home Reports:

Single Survey  
Energy Performance Certificate  
Mortgage Valuation Report

Energy Performance Certificates – domestic & commercial

SAP Assessments

For further information on any of these services please contact us on

(01856 811765) or (07585 447329)

or

[billy@orkneysurveying.co.uk](mailto:billy@orkneysurveying.co.uk)

# Home Report



**Property address:** Sharlea  
Galaha  
Orphir  
Orkney  
KW17 2RB

**Customer:** Mr & Mrs Whitton

**Address:** Sharlea  
Galaha  
Orphir  
Orkney  
KW17 2RB

**Date of inspection:** 14<sup>th</sup> March 2024

## 1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without the need to move any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right are taken facing the front of the property.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. were not inspected or reported on.

|  |   |
|--|---|
| <b>Description</b>                               | Sharlea comprises a detached bungalow with conservatory, attached garage/store and garden ground.   |
| <b>Accommodation</b>                             | Sitting Room, Kitchen, Three (3nr) Bedrooms, Bathroom, Hall, Vestibule.   |
| <b>Gross internal floor area (m<sup>2</sup>)</b> | The gross internal floor area of the property is approximately 75m <sup>2</sup> .   |
| <b>Neighbourhood and location</b>                | The property is situated in a small rural housing development.  |
| <b>Age</b>                                       | The property is thought to have been completed around 1980.<br>Internal alterations were carried out (under a Building Warrant) between 1999 and 2002.<br>The Conservatory was added around 2006. |
| <b>Weather</b>                                   | The weather was cool and bright, following a period of changeable weather.  |
| <b>Chimney stacks</b>                            | There are no chimney stacks.<br><br><i>Visually inspected with the use of binoculars where appropriate.</i>   |

### Roofing including roof space

Pitched timber framed roof structure, clad with plywood sarking and profiled concrete tiles.  
Concrete ridge tiles.  
Fibreglass insulation to the ceiling joists.  
The roof space is accessed via a ceiling hatch and pull-down ladder in the Hall; the roof space is partly floored.

*Sloping roofs were visually inspected with the aid of binoculars where appropriate.*

*Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.*

### Rainwater fittings

uPVC gutters and down pipes.

*Visually inspected with the aid of binoculars where appropriate.*

### Main walls

The main walls consist of a structural timber frame, with block-work outer leaf.  
Dry-dash external finish; smooth render to the ingoes and below DPC level; concrete window cills.

*Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected.*

### Windows, external doors and joinery

uPVC double glazed windows and external doors; it is understood that the windows were replaced in 2023.  
Fascia boards and soffits, clad with a mixture of timber, plywood and uPVC.  
uPVC lining boards to external wall linings above and below Sitting Room window.

*Internal and external doors were opened and closed where keys were available.*

*Random windows were opened and closed where possible.*

*Doors and windows were not forced open.*

### External decorations

The timber fascia boards and plywood soffits are painted.

*Visually inspected.*

### Conservatories / porches

There is a conservatory to the west and part of the north elevation, consisting of blockwork dwarf walls, white uPVC double glazed windows and roof glazing.

It is understood that the Conservatory was added around 2006.

The conservatory is heated.

Internal area is approximately 20m<sup>2</sup>.

*Visually inspected.*

### Communal areas

There are no communal areas.

*Circulation areas visually inspected.*

### Garages and permanent outbuildings

There is an attached garage, with storeroom to the rear, to the eastern elevation of the house, consisting of a painted concrete floor, block walls, a flat roof clad with roofing felt, sectional garage door, uPVC back doors.

Internal dimensions approximately 9m x 3m.

*Visually inspected.*

### Outside areas and boundaries

The property is surrounded by garden areas, which are mainly laid to grass.

Gravelled driveway with concrete apron in front of the garage door.

Block walls and timber fences to the boundaries.

Concrete paths around the house.

Timber decking outside the Conservatory patio doors.

*Visually inspected.*

### Ceilings

The ceilings are lined with plasterboard.

*Visually inspected from floor level.*

### Internal walls

Interior walls and partitions are timber framed and lined with plasterboard.

*Visually inspected from floor level.*

*Using a moisture meter, walls were randomly tested for dampness where considered appropriate.*

### Floors including sub floors

Suspended timber floor.  
Per the current owners, underfloor insulation has been installed. There was no access to inspect this at the time of the survey.

*Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.  
No access to inspect the sub-floor areas.*

### Internal joinery and kitchen fittings

Fitted floor and wall units to the Kitchen (understood to have been newly fitted approximately 2 years ago).  
Oak glazed and panelled interior doors.  
Walk-in wardrobe to the Master Bedroom, with louvred doors; wardrobe recess to one of the other Bedrooms.  
Cupboard off the Hall.  
Timber window cills and plywood ingoes; softwood skirtings and facings.

*Built-in cupboards were looked into but no stored items were moved.  
Kitchen units were visually inspected excluding appliances.*

### Chimney breasts and fireplaces

There are no chimney breasts or fireplaces.

*Visually inspected. No testing of the flues or fittings was carried out.*

### Internal decorations

Internal walls are painted or wallpapered; ceilings are painted or finished with textured plaster.  
Note: the textured plaster may contain asbestos, depending on age.  
Interior woodwork is varnished.  
Tiled splashbacks to the Kitchen and Bathroom.  
Floor finishes include carpet to the Sitting Room and Bedrooms, laminate to the Hall, vinyl to the Kitchen and Bathroom.

*Visually inspected.*

### Cellars

There are no cellars.

*Visually inspected where there was safe and purpose-built access.*

**Electricity**

The property is served by a mains electricity supply to a distribution board and a single tariff in a cupboard in the Hall.

Extractor hood to the Kitchen; extractor fan to the Bathroom.

Fitted electric oven.

It is understood that there is a fibre connection to the property.

*Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.*

**Gas**

There is no mains gas in Orkney.

Gas hob in the Kitchen, with a Calor Gas supply.

*Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.*

**Water, plumbing and bathroom fittings**

There is a mains water supply to the property.

The pipework, where visible, is of copper and uPVC construction.

Sanitary ware includes:

Kitchen: 1.5 bowl stainless steel sink and drainer.

Bathroom: bath with electric shower above, wash-hand basin & WC.

Insulated cold water header tank in the roof space.

*Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances.*



### Heating and hot water

The house is heated by an oil combi boiler in the store to the rear of the garage, heating radiators throughout the house. The heating system is controlled by a programmer, wall thermostat and TRV's fitted to the radiators.

Hot water is also assumed to be provided from the oil combi boiler.

Plastic oil tank on a plinth to the side of the house.

*Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.*

*No tests whatsoever were carried out to the system or appliances.*

### Drainage

Drainage is understood to connect to a local mains drainage system.

*Drainage covers etc were not lifted.*

*Neither drains nor drainage systems were tested.*

### Fire, smoke and burglar alarms

Smoke detectors fitted to the ceilings of the Sitting Room and Hall; high heat alarm to the Kitchen ceiling.

*Visually inspected.*

*No tests whatsoever were carried out to the system or appliances.*

### Any additional limits to inspection:

*At the time of our inspection the property was occupied and fully furnished with floors fully covered throughout.*

*Pitched roof coverings were inspected from ground level; a detailed inspection of condition was not undertaken.*


*An inspection for Japanese Knotweed or other invasive plant species was not carried out.*

*There was no access for inspection to the foundations or behind wall linings.*

*The drainage system was not open to inspection.*

*High levels of Radon gas have been recorded in areas of Orkney. No tests were carried out to detect the levels of gas in the property.*



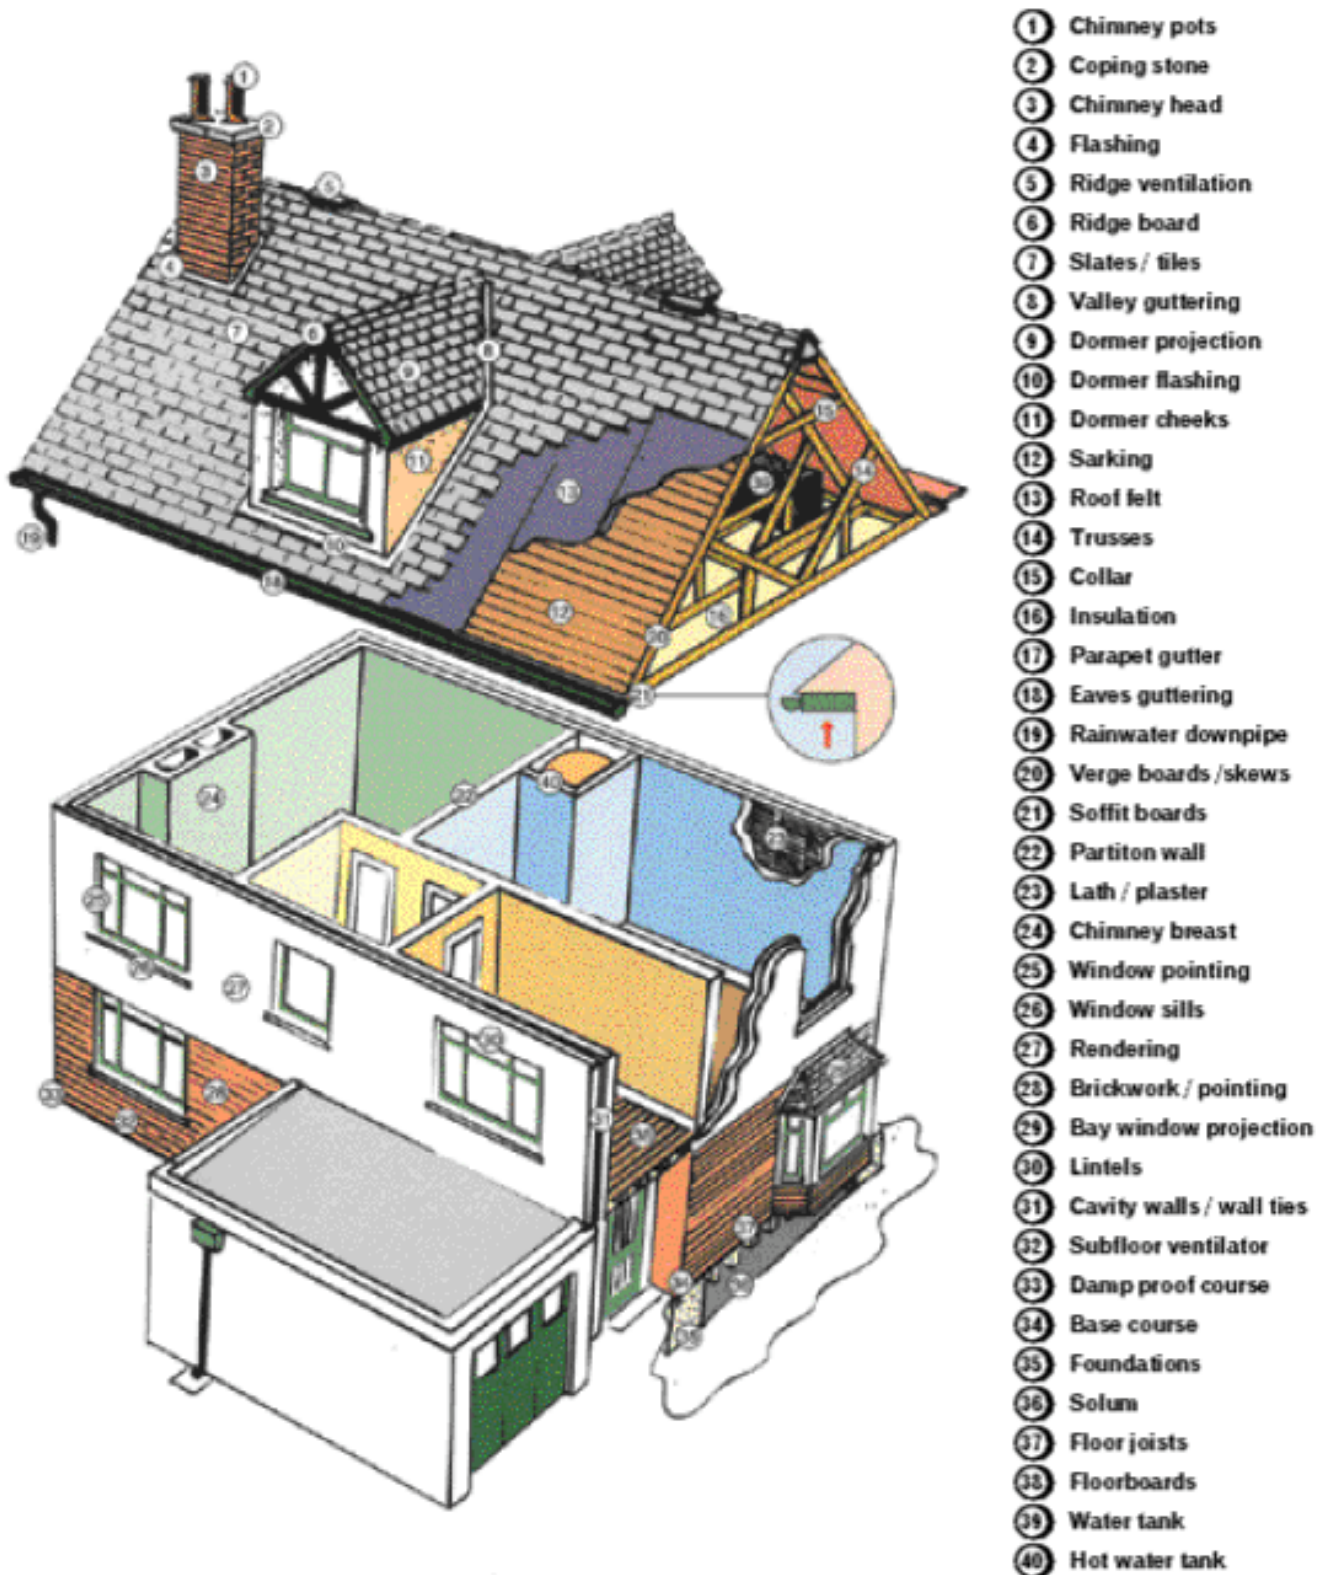





## Sectional diagram showing elements of a typical house












Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these terms.

**2. CONDITION**








This section identifies problems and tells you about the urgency of any repairs by using one of three categories.

| <b>Category 3</b>  | <b>Category 2</b>   | <b>Category 1</b>                        |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised.   | No immediate action or repair is needed. |
|  <b>Structural movement</b>   |   |  |
| Repair category  | 1   |  |
| Notes:   | No significant defects noted.   |  |
|  <b>Dampness, rot and infestation</b>   |   |  |
| Repair category  | 2   |  |
| Notes:   | Some signs of condensation noted to roof trusses and plywood sarking, particularly near the gable walls and above the cold water header tank. |  |
|  <b>Chimney stacks</b>   |   |  |
| Repair category:   | N/A   |  |
| Notes:   | There are no chimney stacks.  |  |
|  <b>Roofing including roof space</b>  |   |  |
| Repair category:   | 1   |  |
| Notes:   | No significant defects noted.   |  |
|  <b>Rainwater fittings</b>  |   |  |
| Repair category:   | 1   |  |
| Notes:   | No significant defects noted.   |  |
|  <b>Main walls</b>  |   |  |
| Repair category:   | 1   |  |
| Notes:   | No significant defects noted.   |  |
|  <b>Windows, external doors and joinery</b>   |   |  |
| Repair category:   | 1   |  |
| Notes:   | No significant defects noted.   |  |
|  <b>External decorations</b>  |   |  |
| Repair category:   | 1   |  |
| Notes:   | No significant defects noted.   |  |

## SINGLE SURVEY

|  |  |
|--|--|
|  <b>Conservatories / porches</b>                |  |
| Repair category:   | 1  |
| Notes:   | No significant defects noted.  |
|  <b>Communal areas</b>                          |  |
| Repair category:   | N/A  |
| Notes:   | There are no communal areas.   |
|  <b>Garages and permanent outbuildings</b>      |  |
| Repair category:   | 2  |
| Notes:   | Decoration to the concrete floor is worn.<br>Cracks noted to garage walls, with signs of previous repairs.<br>The roofing felt to the garage flat roof is weathered, with cracks noted to the perimeter and signs of previous repairs. |
|  <b>Outside areas and boundaries</b>            |  |
| Repair category:   | 2  |
| Notes:   | Cracks and signs of subsidence noted to the concrete paths.<br>The timber fences are weathered.  |
|  <b>Ceilings</b>                              |  |
| Repair category:   | 1  |
| Notes:   | No significant defects noted.  |
|  <b>Internal walls</b>                        |  |
| Repair category:   | 1  |
| Notes:   | No significant defects noted.  |
|  <b>Floors including sub-floors</b>           |  |
| Repair category:   | 1  |
| Notes:   | Broken underfloor vents noted.   |
|  <b>Internal joinery and kitchen fittings</b> |  |
| Repair category:   | 1  |
| Notes:   | No significant defects noted.  |
|  <b>Chimney breasts and fireplaces</b>        |  |
| Repair category:   | N/A  |
| Notes:   | There are no chimney breasts or fireplaces.  |

## SINGLE SURVEY

|   |  |
|---|--|
|    | <b>Internal decorations</b>  |
| Repair category:  | 1  |
| Notes:  | No significant defects noted.  |
|    | <b>Cellars</b>   |
| Repair category:  | N/A  |
| Notes:  | There are no cellars.  |
|    | <b>Electricity</b>   |
| Repair category:  | 1  |
| Notes:  | The electrical installation was not tested.  |
|    | <b>Gas</b>   |
| Repair category:  | 1  |
| Notes:  | The Calor Gas installation was not tested.   |
|   | <b>Water, plumbing and bathroom fittings</b>                                       |
| Repair category:  | 1  |
| Notes:  | The plumbing installation was not tested.  |
|  | <b>Heating and hot water</b>   |
| Repair category:  | 1  |
| Notes:  | The heating and hot water systems were not tested.<br>The oil tank is not secured. |
|  | <b>Drainage</b>  |
| Repair category:  | 1  |
| Notes:  | No access to inspect the underground drainage system.                              |

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

|                                       |     |
|---------------------------------------|-----|
| Structural movement                   | 1   |
| Dampness, rot and infestation         | 2   |
| Chimney stacks                        | N/A |
| Roofing including roof space          | 1   |
| Rainwater fittings                    | 1   |
| Main walls                            | 1   |
| Windows, external doors and joinery   | 1   |
| External decorations                  | 1   |
| Conservatories / porches              | 1   |
| Communal areas                        | N/A |
| Garages and permanent outbuildings    | 2   |
| Outside areas and boundaries          | 2   |
| Ceilings                              | 1   |
| Internal walls                        | 1   |
| Floors including sub-floors           | 1   |
| Internal joinery and kitchen fittings | 1   |
| Chimney breasts and fireplaces        | N/A |
| Internal decorations                  | 1   |
| Cellars                               | N/A |
| Electricity                           | 1   |
| Gas                                   | 1   |
| Water, plumbing and bathroom fittings | 1   |
| Heating and hot water                 | 1   |
| Drainage                              | 1   |

**Repair Categories**

**Category 3:**  
Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

**Category 2:**  
Repairs or replacement requiring future attention, but estimates are still advised.

**Category 1:**  
No immediate action or repair is needed.

**Remember**

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

**Warning**

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

**3. ACCESSIBILITY INFORMATION**

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes: Parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

|   |               |
|---|---------------|
| <b>1. Which floor(s) is the living accommodation on?</b>                                      | <b>Ground</b> |
| <b>2. Are there three steps or fewer to a main entrance door of the property?</b>             | <b>No</b>     |
| <b>3. Is there a lift to the main entrance door of the property?</b>                          | <b>No</b>     |
| <b>4. Are all door openings greater than 750mm?</b>   | <b>No</b>     |
| <b>5. Is there a toilet on the same level as the living room and kitchen?</b>                 | <b>Yes</b>    |
| <b>6. Is there a toilet on the same level as a bedroom?</b>                                   | <b>Yes</b>    |
| <b>7. Are all rooms on the same level with no internal steps or stairs?</b>                   | <b>Yes</b>    |
| <b>8. Is there unrestricted parking within 25 metres of an entrance door to the building?</b> | <b>Yes</b>    |

#### 4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

##### Matters for a solicitor or licensed conveyancer

Check

- Rights and responsibilities for mutual parts, boundaries etc.
- That the Title is clean and Heritable with no onerous burdens or conditions.

##### Estimated re-instatement cost for insurance purposes


£350,000 (Three Hundred and Fifty Thousand Pounds).

##### Valuation and market comments

The market value of the property as described in this report is £265,000 (Two Hundred and Sixty-Five Thousand Pounds).

This figure assumes vacant possession and that the property is unaffected by adverse planning proposals, onerous burdens, title restrictions and servitude rights.

Signed

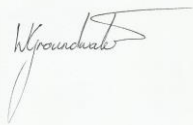

**Surveyors Name**

Billy Groundwater, AssocRICS

**Company Name**

Orkney Surveying Services

**Address:**

Castlehowe, Sower Road, Orphir, Orkney, KW17 2RE

**Date of report:**

20<sup>th</sup> March 2024



# Energy Performance Certificate (EPC)

# Scotland

Dwellings

SHARLEA, GALAHA, ORPHIR, ORKNEY, KW17 2RB

**Dwelling type:** Detached bungalow  
**Date of assessment:** 14 March 2024  
**Date of certificate:** 20 March 2024  
**Total floor area:** 75 m<sup>2</sup>  
**Primary Energy Indicator:** 245 kWh/m<sup>2</sup>/year


**Reference number:** 8014-5227-9000-0134-8292  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, oil

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

|  |               |  |
|--|---------------|--|
| <b>Estimated energy costs for your home for 3 years*</b> | <b>£3,540</b> | See your recommendations report for more information |
| <b>Over 3 years you could save*</b>                      | <b>£825</b>   |  |

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

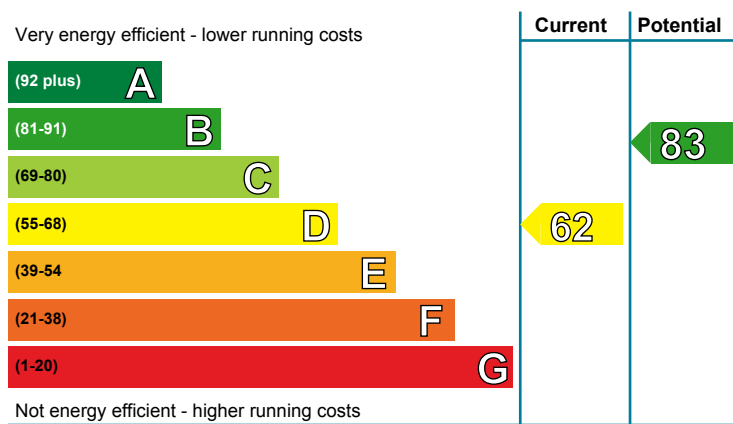


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (62)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

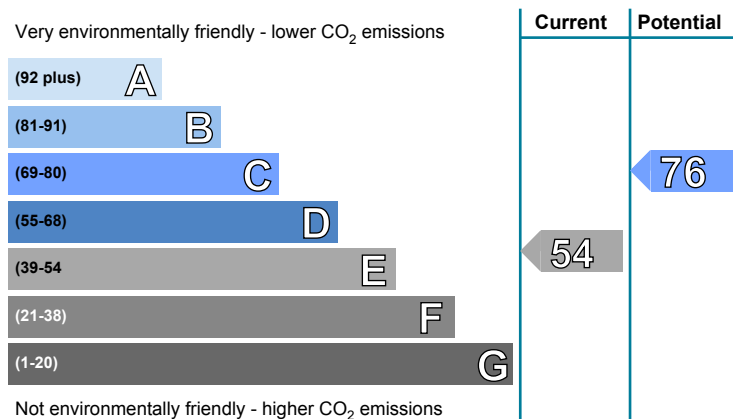

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (54)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

| Recommended measures                 | Indicative cost | Typical savings over 3 years |
|--------------------------------------|-----------------|------------------------------|
| 1 Floor insulation (suspended floor) | £800 - £1,200   | £513.00                      |
| 2 Condensing boiler                  | £2,200 - £3,000 | £171.00                      |
| 3 Solar water heating                | £4,000 - £6,000 | £144.00                      |

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

| Element               | Description                                 | Energy Efficiency | Environmental |
|-----------------------|---|-------------------|---------------|
| Walls                 | Timber frame, as built, insulated (assumed) | ★★★★☆             | ★★★★☆         |
| Roof                  | Pitched, 250 mm loft insulation             | ★★★★☆             | ★★★★☆         |
| Floor                 | Suspended, no insulation (assumed)          | —                 | —             |
| Windows               | Mostly double glazing                       | ★★★★☆             | ★★★★☆         |
| Main heating          | Boiler and radiators, oil                   | ★★★☆☆             | ★★★☆☆         |
| Main heating controls | Programmer, room thermostat and TRVs        | ★★★★☆             | ★★★★☆         |
| Secondary heating     | None  | —                 | —             |
| Hot water             | From main system                            | ★★☆☆☆             | ★★★☆☆         |
| Lighting              | Low energy lighting in all fixed outlets    | ★★★★★             | ★★★★★         |

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 64 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 4.8 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.1 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.









### Estimated energy costs for this home

|               | Current energy costs | Potential energy costs | Potential future savings  |
|---------------|----------------------|------------------------|---|
| Heating       | £2,664 over 3 years  | £1,713 over 3 years    |  |
| Hot water     | £561 over 3 years    | £687 over 3 years      |   |
| Lighting      | £315 over 3 years    | £315 over 3 years      |   |
| <b>Totals</b> | <b>£3,540</b>        | <b>£2,715</b>          |   |

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

### Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

| Recommended measures                        | Indicative cost | Typical saving per year | Rating after improvement  |   |
|---|-----------------|-------------------------|---|---|
|   |                 |                         | Energy  | Environment   |
| 1 Floor insulation (suspended floor)        | £800 - £1,200   | £171                    |  |  |
| 2 Replace boiler with new condensing boiler | £2,200 - £3,000 | £57                     |  |  |
| 3 Solar water heating                       | £4,000 - £6,000 | £48                     |  |  |
| 4 Solar photovoltaic panels, 2.5 kWp        | £3,500 - £5,500 | £507                    |  |  |

### Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 2 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

### 3 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

### 4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

| Heat demand                  | Existing dwelling | Impact of loft insulation | Impact of cavity wall insulation | Impact of solid wall insulation |
|------------------------------|-------------------|---------------------------|----------------------------------|---------------------------------|
| Space heating (kWh per year) | 9,464             | N/A                       | N/A                              | N/A                             |
| Water heating (kWh per year) | 2,059             |                           |                                  |                                 |

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

|                             |  |
|-----------------------------|--|
| Assessor's name:            | Mr. William Groundwater  |
| Assessor membership number: | EES/019552   |
| Company name/trading name:  | Orkney Surveying Services  |
| Address:                    | Castlehowe Sower Road<br>Orphir<br>Orkney Islands<br>Orkney<br>KW17 2RE      |
| Phone number:               | 01856 811765   |
| Email address:              | <a href="mailto:billy@orkneysurveying.co.uk">billy@orkneysurveying.co.uk</a> |
| Related party disclosure:   | No related party   |

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT



# property questionnaire

## Note for sellers

- Please complete this form carefully. It is important your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell you solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

|           |   |
|-----------|---|
| <b>1.</b> | <b>Length of Ownership</b>  |
|           | How long have you owned the property? <input type="text" value="26 years"/>   |
| <b>2.</b> | <b>Council Tax</b>  |
|           | Which Council Tax band is your property in?<br><input type="checkbox"/> A <input type="checkbox"/> B <input checked="" type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input type="checkbox"/> G <input type="checkbox"/> H   |
| <b>3.</b> | <b>Parking</b>  |
|           | What are the arrangements for parking at your property?<br>(Please tick all that apply)<br>Garage <input checked="" type="checkbox"/><br>Allocated parking space <input type="checkbox"/><br>Driveway <input checked="" type="checkbox"/><br>On street <input type="checkbox"/><br>Resident Permit <input type="checkbox"/><br>Metered parking <input type="checkbox"/><br>Shared parking <input type="checkbox"/><br>Other (please specify) <input type="text"/> |

# property questionnaire

|           |   |  |
|-----------|---|--|
| <b>4.</b> | <b>Conservation area</b>  |  |
|           | Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?  | <b>No</b>  |
| <b>5.</b> | <b>Listed buildings</b>   |  |
|           | Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?  | <b>No</b>  |
| <b>6.</b> | <b>Alterations/Additions/Extensions</b>   |  |
| <b>a.</b> | <p><b>(i)</b> During your time in the property, have you carried out any structural alterations, additions or extensions (for example provision of an extra bath/shower room, toilet or bedroom)?<br/> <u>If you have answered yes</u>, please describe below the changes which you have made:</p> <div style="border: 1px solid black; padding: 5px; margin: 10px 0;">                     installed combi-boiler and Oil Tank 1999<br/>                     added conservatory - 2006                 </div> <p><b>(ii)</b> Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them.</p> | <p><b>Yes</b></p> <p><b>Yes</b></p>                  |
| <b>b.</b> | <p>Have you had replacement windows, doors, patio doors or double-glazing installed in your property? If you have answered yes, please answer the three questions below:</p> <p><b>(i)</b> Were the replacements the same shape and type as the ones you replaced? <b>Yes</b></p> <p><b>(ii)</b> Did this work involve any changes to the window or door openings? <b>No</b></p> <p><b>(iii)</b> Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):</p> <div style="border: 1px solid black; padding: 5px; margin: 10px 0;">                     March 2023 - new windows fitted.                 </div>   | <p><b>Yes</b></p> <p><b>Yes</b></p> <p><b>No</b></p> |



# property questionnaire

|           |  |                                    |
|-----------|--|------------------------------------|
| <b>7.</b> | <b>Central heating</b>   |                                    |
|           | <p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes or partial</u> – what kind of central heating is there?</p> <div data-bbox="156 465 1147 533" style="border: 1px solid black; padding: 2px;">Heating Oil - Kerosine</div> <p>(examples: gas-fired, solid fuel, electric storage heating, gas-warm air).</p> <p>If you have answered yes, please answer the three questions below:</p>  | <b>Yes</b>                         |
|           | <p><b>(i)</b> When was your central heating system or partial central heating system installed?</p> <div data-bbox="156 797 1147 864" style="border: 1px solid black; padding: 2px;">1999</div> <p><b>(ii)</b> Do you have a maintenance contract for the central heating system?</p> <p>If you have answered yes, please give details of the company with which you have a maintenance contract:</p> <div data-bbox="156 1066 1147 1133" style="border: 1px solid black; padding: 2px;">N/A</div> <p><b>(iii)</b> When was your maintenance agreement last renewed?<br/>(Please provide the month and year).</p> <div data-bbox="156 1267 1147 1335" style="border: 1px solid black; padding: 2px;">N/A</div> | <b>No</b>                          |
| <b>8.</b> | <b>Energy Performance Certificate</b>  |                                    |
|           | Does your property have an Energy Performance Certificate, which is less than 10 years old?  | <b>No</b>                          |
| <b>9.</b> | <b>Issues that may have affected your property</b>   |                                    |
| <b>a.</b> | <p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p>  | <p><b>No</b></p> <p><b>N/A</b></p> |

# property questionnaire

| b.                                  | <p>Are you aware of the existence of asbestos in your property?</p> <p><u>If you have answered yes</u>, please give details:</p> <div style="border: 1px solid black; height: 40px; width: 100%;"></div>   | No   |           |          |                             |                                     |  |                                     |                                     |  |             |                                     |   |                |                                     |  |           |                                     |  |                       |                                     |   |           |                                     |  |  |
|-------------------------------------|--|--|-----------|----------|-----------------------------|-------------------------------------|--|-------------------------------------|-------------------------------------|--|-------------|-------------------------------------|---|----------------|-------------------------------------|--|-----------|-------------------------------------|--|-----------------------|-------------------------------------|---|-----------|-------------------------------------|--|--|
| 10.                                 | <b>Services</b>  |  |           |          |                             |                                     |  |                                     |                                     |  |             |                                     |   |                |                                     |  |           |                                     |  |                       |                                     |   |           |                                     |  |  |
| a.                                  | <p>Please tick which services are connected to your property and give details of the supplier:</p> <table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="text-align: left;">Services</th> <th style="text-align: center;">Connected</th> <th style="text-align: left;">Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td><div style="border: 1px solid black; padding: 2px;">Bottled Gas -<br/>Cooker Hob</div></td> </tr> <tr> <td>Water mains or private water supply</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td><div style="border: 1px solid black; padding: 2px;">Scottish Water</div></td> </tr> <tr> <td>Electricity</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td><div style="border: 1px solid black; padding: 2px;">EDF</div></td> </tr> <tr> <td>Mains drainage</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td><div style="border: 1px solid black; padding: 2px;">Scottish Water</div></td> </tr> <tr> <td>Telephone</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td><div style="border: 1px solid black; padding: 2px;">CloudNet</div></td> </tr> <tr> <td>Cable TV or satellite</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td><div style="border: 1px solid black; padding: 2px;">Sky</div></td> </tr> <tr> <td>Broadband</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td><div style="border: 1px solid black; padding: 2px;">BT</div></td> </tr> </tbody> </table> | Services   | Connected | Supplier | Gas or liquid petroleum gas | <input checked="" type="checkbox"/> | <div style="border: 1px solid black; padding: 2px;">Bottled Gas -<br/>Cooker Hob</div> | Water mains or private water supply | <input checked="" type="checkbox"/> | <div style="border: 1px solid black; padding: 2px;">Scottish Water</div> | Electricity | <input checked="" type="checkbox"/> | <div style="border: 1px solid black; padding: 2px;">EDF</div> | Mains drainage | <input checked="" type="checkbox"/> | <div style="border: 1px solid black; padding: 2px;">Scottish Water</div> | Telephone | <input checked="" type="checkbox"/> | <div style="border: 1px solid black; padding: 2px;">CloudNet</div> | Cable TV or satellite | <input checked="" type="checkbox"/> | <div style="border: 1px solid black; padding: 2px;">Sky</div> | Broadband | <input checked="" type="checkbox"/> | <div style="border: 1px solid black; padding: 2px;">BT</div> |  |
| Services                            | Connected  | Supplier   |           |          |                             |                                     |  |                                     |                                     |  |             |                                     |   |                |                                     |  |           |                                     |  |                       |                                     |   |           |                                     |  |  |
| Gas or liquid petroleum gas         | <input checked="" type="checkbox"/>  | <div style="border: 1px solid black; padding: 2px;">Bottled Gas -<br/>Cooker Hob</div> |           |          |                             |                                     |  |                                     |                                     |  |             |                                     |   |                |                                     |  |           |                                     |  |                       |                                     |   |           |                                     |  |  |
| Water mains or private water supply | <input checked="" type="checkbox"/>  | <div style="border: 1px solid black; padding: 2px;">Scottish Water</div>               |           |          |                             |                                     |  |                                     |                                     |  |             |                                     |   |                |                                     |  |           |                                     |  |                       |                                     |   |           |                                     |  |  |
| Electricity                         | <input checked="" type="checkbox"/>  | <div style="border: 1px solid black; padding: 2px;">EDF</div>                          |           |          |                             |                                     |  |                                     |                                     |  |             |                                     |   |                |                                     |  |           |                                     |  |                       |                                     |   |           |                                     |  |  |
| Mains drainage                      | <input checked="" type="checkbox"/>  | <div style="border: 1px solid black; padding: 2px;">Scottish Water</div>               |           |          |                             |                                     |  |                                     |                                     |  |             |                                     |   |                |                                     |  |           |                                     |  |                       |                                     |   |           |                                     |  |  |
| Telephone                           | <input checked="" type="checkbox"/>  | <div style="border: 1px solid black; padding: 2px;">CloudNet</div>                     |           |          |                             |                                     |  |                                     |                                     |  |             |                                     |   |                |                                     |  |           |                                     |  |                       |                                     |   |           |                                     |  |  |
| Cable TV or satellite               | <input checked="" type="checkbox"/>  | <div style="border: 1px solid black; padding: 2px;">Sky</div>                          |           |          |                             |                                     |  |                                     |                                     |  |             |                                     |   |                |                                     |  |           |                                     |  |                       |                                     |   |           |                                     |  |  |
| Broadband                           | <input checked="" type="checkbox"/>  | <div style="border: 1px solid black; padding: 2px;">BT</div>                           |           |          |                             |                                     |  |                                     |                                     |  |             |                                     |   |                |                                     |  |           |                                     |  |                       |                                     |   |           |                                     |  |  |
| b.                                  | <p><b>Is there a septic tank system at your property?</b></p> <p><u>If you have answered yes</u>, please answer the two questions below:</p> <p><b>(i)</b> Do you have appropriate consents for the discharge from your septic tank?</p> <p><b>(ii)</b> Do you have a maintenance contract for your septic tank?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</p> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;">                 Septic Tank operated via Council Tax through to Scottish Water - cummunial tank             </div>  | <p>No</p> <p>N/A</p> <p>N/A</p>  |           |          |                             |                                     |  |                                     |                                     |  |             |                                     |   |                |                                     |  |           |                                     |  |                       |                                     |   |           |                                     |  |  |

# property questionnaire

| 11. | Responsibilities for shared or common areas   |           |
|-----|---|-----------|
| a.  | <p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes</u>, please give details:</p> <div data-bbox="156 465 1150 638" style="border: 1px solid black; height: 77px;"></div>     | <b>No</b> |
| b.  | <p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes</u>, please give details:</p> <div data-bbox="156 869 1150 1041" style="border: 1px solid black; height: 77px;"></div>   | <b>No</b> |
| c.  | <p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>  | <b>No</b> |
| d.  | <p>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes</u>, please give details:</p> <div data-bbox="156 1404 1150 1576" style="border: 1px solid black; height: 77px;"></div>                           | <b>No</b> |
| e.  | <p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes</u>, please give details:</p> <div data-bbox="156 1839 1150 2011" style="border: 1px solid black; height: 77px;"></div> | <b>No</b> |

# property questionnaire

|     |   |                      |
|-----|---|----------------------|
| f.  | <p>As far as you are aware, is there a public right of way across any part of your property (public right of way is a way over privately-owned)?</p> <p><u>If you have answered yes</u>, please give details:</p> <div data-bbox="156 360 1150 535" style="border: 1px solid black; height: 78px; width: 623px;"></div> | No                   |
| 12. | <b>Charges associated with your property</b>  |                      |
| a.  | <p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes</u>, please provide the name and address, and give details of any deposit held and approximate charges:</p> <div data-bbox="156 848 1150 1023" style="border: 1px solid black; height: 78px; width: 623px;"></div>       | No                   |
| b.  | <p>Is there a common buildings insurance policy?</p> <p><u>If you have answered yes</u>, is the cost of the insurance included in your monthly/annual factor's charges?</p>   | <p>No</p> <p>N/A</p> |
| c.  | <p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p> <div data-bbox="156 1473 1150 1641" style="border: 1px solid black; height: 75px; width: 623px;">N/A</div>    |                      |

# property questionnaire

| 13. | Specialist works  |            |
|-----|---|------------|
| a.  | <p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?<br/>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:</p> <div data-bbox="156 474 1149 645" style="border: 1px solid black; height: 76px; width: 622px;"></div>  | <b>No</b>  |
| b.  | <p>As far as you were aware, has any preventative work for dry rot, wet rot, or damp, ever been carried out to your property?<br/><u>If you have answered yes</u>, please give details:</p> <div data-bbox="156 887 1149 1057" style="border: 1px solid black; height: 76px; width: 622px;"></div>  | <b>No</b>  |
| c.  | <p><u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work?<br/><u>If you have answered yes</u> these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:</p> <div data-bbox="156 1460 1149 1559" style="border: 1px solid black; height: 44px; width: 622px;"></div> | <b>N/A</b> |

# property questionnaire

|            |  |   |
|------------|--|---|
| <b>14.</b> | <b>Guarantees</b>  |   |
| <b>a.</b>  | <p>Are there any guarantees or warranties for any of the following:</p> <ul style="list-style-type: none"> <li><b>(i)</b> Electrical work</li> <li><b>(ii)</b> Roofing</li> <li><b>(iii)</b> Central heating</li> <li><b>(iv)</b> National House Building Council (NHBC)</li> <li><b>(v)</b> Damp course</li> <li><b>(vi)</b> Any other work or installations (for example, cavity wall insulation, underpinning, indemnity policy)</li> </ul> | <p><b>No</b></p> <p><b>No</b></p> <p><b>No</b></p> <p><b>No</b></p> <p><b>No</b></p> <p><b>No</b></p> |
| <b>b.</b>  | <p>If you have answered yes or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</p> <div data-bbox="156 920 1150 1093" style="border: 1px solid black; height: 77px; width: 623px;"></div>  |   |
| <b>c.</b>  | <p>Are there any outstanding claims under any of the guarantees listed above?</p> <p><u>If you have answered yes</u>, please give details:</p> <div data-bbox="156 1344 1150 1516" style="border: 1px solid black; height: 77px; width: 623px;"></div>   | <p><b>No</b></p>  |
| <b>15.</b> | <b>Boundaries</b>  |   |
|            | <p>So far as you are aware, has any boundary of your property been moved in the last 10 years?</p> <p><u>If you have answered yes</u>, please give details:</p> <div data-bbox="156 1814 1150 1986" style="border: 1px solid black; height: 77px; width: 623px;"></div>  | <p><b>No</b></p>  |

# property questionnaire

| 16. | Notices that affect your property   |   |
|-----|---|---|
|     | <p><b>In the past three years have you ever received a notice:</b></p> <p>a. advising that the owner of a neighbouring property has made a planning application?</p> <p>b. that affects your property in some other way?</p> <p>c. that requires you to do any maintenance, repairs or improvements to your property?</p> <p><i>If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</i></p> | <p><b>Yes</b></p> <p><b>No</b></p> <p><b>No</b></p> |

## Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): \_\_\_\_\_

Date: 13 MAR 2024

## PART 1 – GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.<sup>1</sup>

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The/-

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.



The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

### **1.3 LIABILITY**

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

### **1.4 INTELLECTUAL PROPERTY**

Any intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

### **1.5 PAYMENT**

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

### **1.6 CANCELLATION**

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection. /-

## TERMS AND CONDITIONS

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

### 1.7 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

### 1.8 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Market Value" is *The estimated amount for which a Property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member of partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct

### PART 2 – DESCRIPTION OF THE REPORT

#### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company.

#### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

#### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyors opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

**WARNING: /-**

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable. Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

### 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

### 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

### 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

*Market Value* "The estimated amount for which a property should exchange on the date of valuation within a willing buyer and a willing seller in an arms-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion." In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc from the valuation. In the case of flats, the following further assumptions are made that:

- \*There are rights of access and exit over all communal roadways, corridors, stairways etc and to use communal grounds, parking areas, and other facilities;
- \*There are no particularly troublesome or unusual legal restrictions;
- \*There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" /-

## TERMS AND CONDITIONS

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.