

ALFRED FLETT LTD

Architectural & Surveying Services



Home Report

**7 Broadsands Road
Kirkwall
Orkney
KW15 1BP**

Tel: 01856 781209

e-mail: enquiries@alfredflett.co.uk

Web: www.enquiries@alfredflett.co.uk



ALFRED FLETT LTD

Architectural & Surveying Services



Surveying Services

Home Reports

Property Condition Surveys

Energy Performance Certificates (EPC's)

SAP Certifications

Title Deed Surveys

Property Valuations

RICS Home Surveys

Architectural Services

Drone Surveys

Full Design Services including 3D interactive views

High quality render packages

Planning & Building Warrant Applications

Principal Designer Duties

Tel: 01856 781209

e-mail: enquiries@alfredflett.co.uk

Web: www.enquiries@alfredflett.co.uk



Home Report



Property address: 7 Broadsands Road
Kirkwall
Orkney
KW15 1BP

Customer:

Address: c/o 7 Broadsands Road
Kirkwall
Orkney
KW15 1BP

Date of inspection: 13th July 2026

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without the need to move any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right are taken facing the front of the property.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. were not inspected or reported on.

Description	7 Broadsands Road comprises a two-storey semi-detached house with garden ground.
Accommodation	Ground Floor: Sitting Room, Bedroom, Kitchen, Front & Rear Halls, Bathroom, En-Suite Shower Room/Wetroom. First Floor: Three (3nr) Bedrooms, Landing.
Gross internal floor area (m²)	The gross internal floor area of the property is approximately 117m ² .
Neighbourhood and location	The property is situated in a residential area of Kirkwall, within easy reach of all the usual amenities.
Age	The original property is understood to date from the 1950's. The rear Kitchen/Bedroom extension was added around 2000.
Weather	Dry, warm and sunny, following a period of settled weather.

Chimney stacks

There is a chimney stack to the party wall, which is shared with the adjoining property.
The chimney stack is assumed to be block or brick built and is rendered, with a concrete cope and multiple clay chimney cans; leadwork flashings to the base of the chimney.

*Visually inspected with the use of binoculars **where appropriate.***

Roofing including roof space

Pitched timber framed roof structure to the original part of the house, clad with fibre-cement slates; clay ridge tiles.

Note: the fibre-cement roof slates may contain asbestos, depending on their age.

Timber sarking boards; fibreglass insulation to the ceiling joists.

Flat roof to the rear Kitchen/Bedroom extension with fibreglass roof coverings.

*Sloping roofs were visually inspected with the aid of binoculars **where appropriate.***

Head & shoulders inspection of the roof space.

Rainwater fittings

uPVC gutters and down pipes.

*Visually inspected with the aid of binoculars **where appropriate.***

Main walls

The external walls consist of a structural timber frame, with marine plywood external cladding.

Note: it is understood that most of the external marine cladding was replaced in 2020.

Brickwork party wall.

*Visually inspected with the aid of binoculars **where appropriate.***

Foundations and concealed parts were not exposed or inspected.

Windows, external doors and joinery

uPVC double glazed windows and external doors of various ages.

uPVC clad fascias and soffits.

Canopy over the front door, with felt clad roof.

Internal and external doors were opened and closed where keys were available.

Random windows were opened and closed where possible.

Doors and windows were not forced open.

External decorations

The plywood external wall cladding is painted.

Visually inspected.

Conservatories / porches

There are no conservatories or porches.

Visually inspected.

Communal areas

There are no communal areas.

Circulation areas visually inspected.

Garages and permanent outbuildings

There are no garages or permanent outbuildings.
Wooden shed to the back garden.

Visually inspected.

Outside areas and boundaries

Garden areas to the front, side and rear of the house.
Small front garden, with gravel and block walls to the boundaries; painted metal garden gate.
Gravelled driveway to the side of the house.
Larger garden to the rear, which is mainly laid to grass, with block boundary walls.
Concrete paths, steps and ramps around the house.
Note: the concrete boundary wall to the front garden is understood to be owned jointly with the OIC – this should be confirmed.

Visually inspected.

Ceilings

The ceilings are lined with plasterboard.

Visually inspected from floor level.

Internal walls

Internal walls and partitions are timber framed and lined with plasterboard.
It is understood that internal wall insulation was installed to the kitchen when the replacement kitchen was installed in 2024.

Visually inspected from floor level.

Using a moisture meter, walls were randomly tested for dampness where considered appropriate.

Floors including sub floors

Suspended timber ground and first floors.
It is understood that floor insulation was installed to the kitchen when the replacement kitchen was installed in 2024.

*Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
No access to inspect the floor construction or structure.*

Internal joinery and kitchen fittings

Fitted floor and wall units to the Kitchen; installed in 2024.
Glazed timber and flush plywood interior doors.
Fitted wardrobes and cupboards, with a mixture of louvred timber and flush plywood doors.
Softwood skirtings and facings.
Timber window cills and plywood ingoes.
Timber staircase, balustrades and handrails.
Vanity unit to the wash-hand basin in the Bathroom, with louvred door.

*Built-in cupboards were looked into but no stored items were moved.
Kitchen units were visually inspected excluding appliances.*

Chimney breasts and fireplaces

Open fire in the Sitting Room, with a tiled hearth and fireplace.
It is understood that there is a back boiler to the fire.

Visually inspected. No testing of the flues or fittings was carried out.

Internal decorations

Internal walls and ceilings are wallpapered or painted.
Interior woodwork is painted or varnished.
Wall panelling to the Kitchen; wall vinyl and tiles to the En-Suite Shower Room; wall tiles to the Bathroom.

Floor finishes consist of carpet, laminate and vinyl.

Visually inspected.

Cellars

There are no cellars.

Visually inspected where there was safe and purpose-built access.

Electricity

The property is served by a mains electricity supply to a distribution board and a single tariff smart meter and a recently replaced consumer unit in the front Hall. Extractor hood to the Kitchen; extractor fan to the En-Suite Shower Room.

Installed appliances in the Kitchen include: electric induction hob, electric fan oven, fridge, dishwasher, washing machine.

Stainless steel switches and sockets in the Kitchen.

Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.

Gas

There is no mains gas in Orkney.

No Calor Gas installation at the property.

Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.

Water, plumbing and bathroom fittings

There is a mains water supply to the property.

The pipework, where visible, is of copper and uPVC construction.

Sanitary ware includes:

Kitchen: single bowl stainless steel sink and drainer.

En-Suite Shower Room/Wetroom: electric shower above dished area of floor, with shower curtain; wash-hand basin; WC.

Bathroom: steel bath with electric shower above; wash-hand basin; WC.

Insulated cold water header tank in the roof space.

External plastic SVP to the rear elevation.

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances.

Heating and hot water

The house is heated by an external oil boiler in a cabinet to the rear elevation, heating radiators throughout the house. Towel rail to the Bathroom.

The heating system is controlled by a programmer in the Kitchen, mobile thermostat (WiFi connected), and TRV's fitted to the radiators.

Plastic oil tank on a raised paving slab base to the rear of the house.

Open fire in the Sitting Room; it is understood that there is a back boiler which helps to heat the hot water.

Insulated hot water cylinder with thermostat in a cupboard off the rear Hall.

Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.

No tests whatsoever were carried out to the system or appliances.

Drainage

Drainage is understood to connect to the mains drainage network.

Drainage covers etc were not lifted.

Neither drains nor drainage systems were tested.

Fire, smoke and burglar alarms

Smoke detectors fitted to the ceilings of the Hall, Sitting Room and first floor Landing; high heat alarm to the Kitchen; CO Alarm in the Sitting Room.

Visually inspected.

No tests whatsoever were carried out to the system or appliances.

Any additional limits to inspection:

At the time of our inspection the property was unoccupied and fully furnished with floors fully covered throughout.

Pitched roof coverings were inspected from ground level; a detailed inspection of condition was not undertaken.


An inspection for Japanese Knotweed or other invasive plant species was not carried out.

There was no access for inspection to the foundations or behind wall linings.

The drainage system was not open to inspection.

High levels of Radon gas have been recorded in areas of Orkney. No tests were carried out to detect the levels of gas in the property.

Sectional diagram showing elements of a typical house

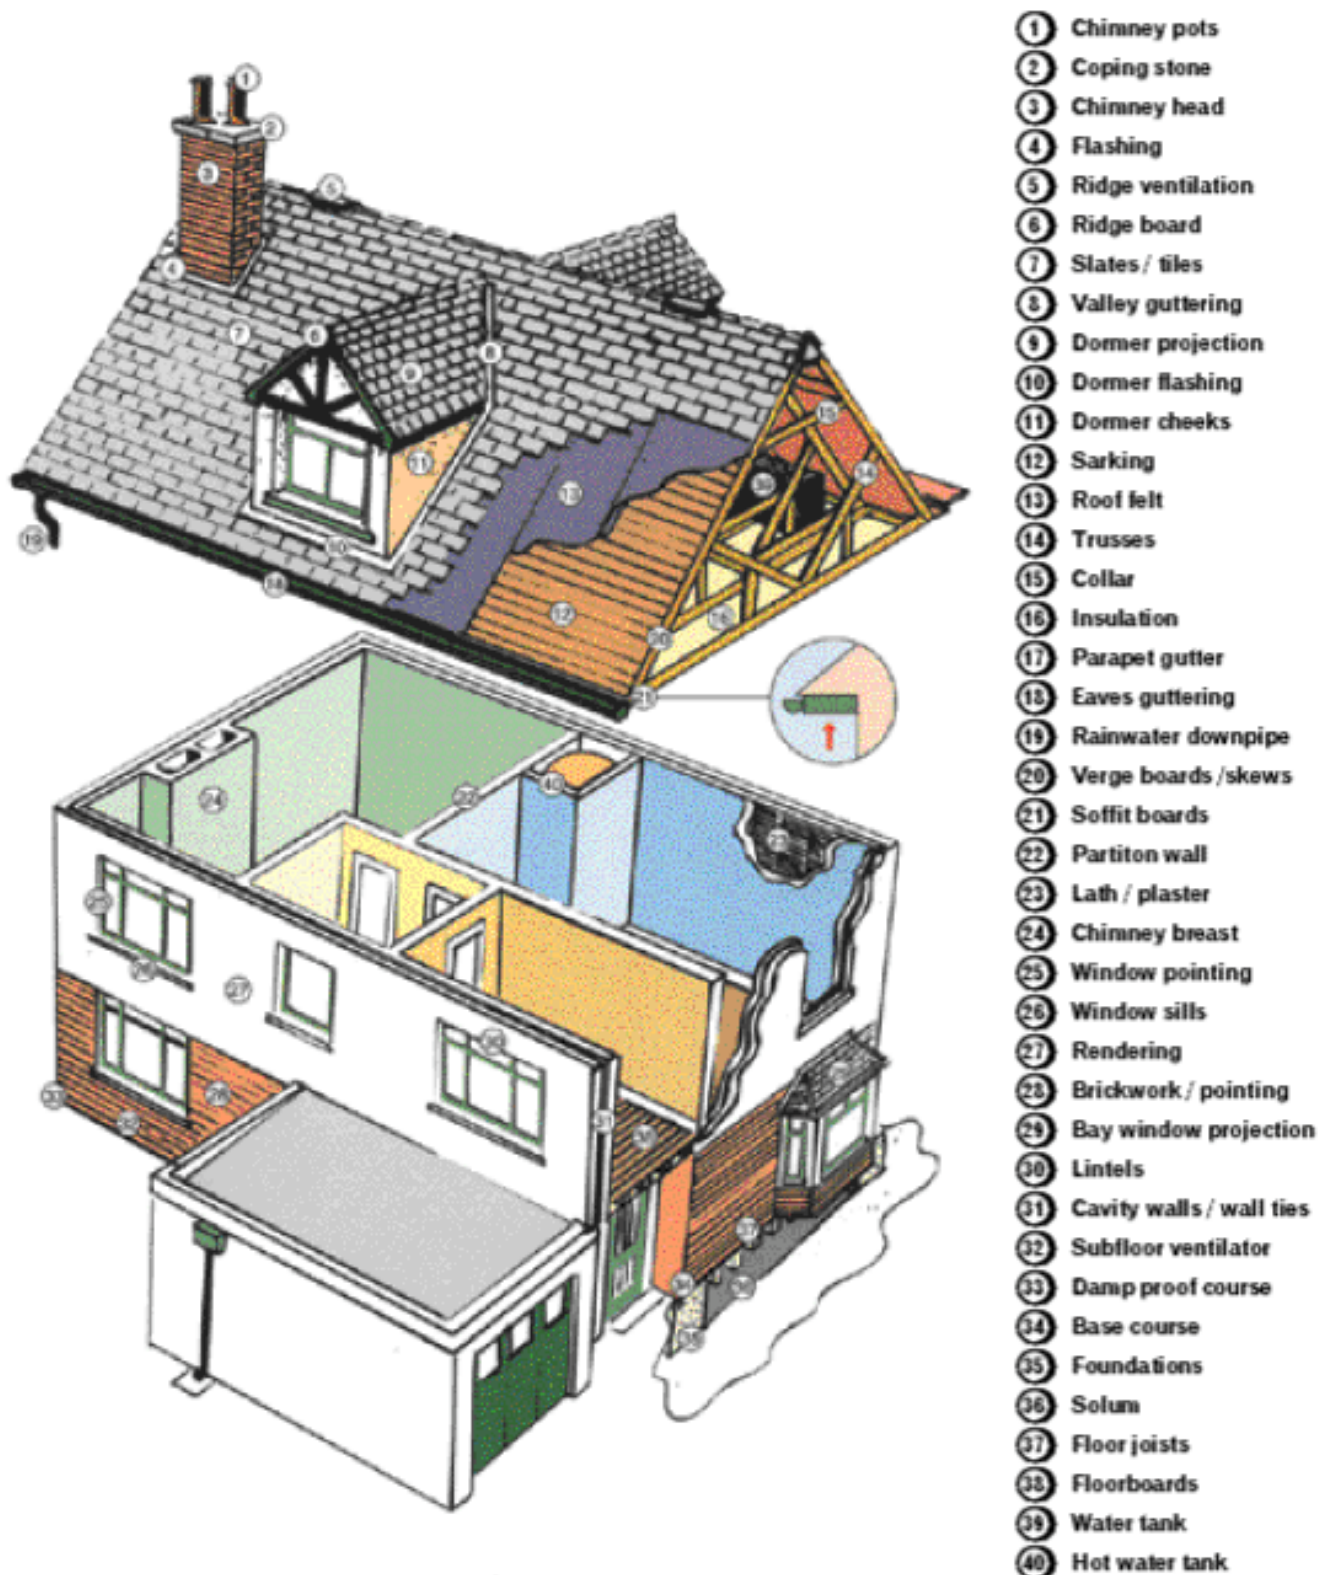

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these terms.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of three categories.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.
 Structural movement		
Repair category	1	
Notes:	No significant defects noted.	
 Dampness, rot and infestation		
Repair category	2	
Notes:	Signs of moisture damage noted to the timber sarking boards in the roof space, adjacent to the gable wall. Some damage noted to the inner surface of the gable wall.	
 Chimney stacks		
Repair category:	2	
Notes:	The render to the chimney stack and the concrete cope are cracked and weathered. Vegetation build-up to the leadwork flashings at the base of the chimney.	
 Roofing including roof space		
Repair category:	2	
Notes:	The fibre-cement roof slates, fibreglass and felt flat roof coverings appear weathered.	
 Rainwater fittings		
Repair category:	1	
Notes:	No significant defects noted.	
 Main walls		
Repair category:	2	
Notes:	Minor localised weathering and rot noted to external wall cladding.	
 Windows, external doors and joinery		
Repair category:	1	
Notes:	No significant defects noted.	

SINGLE SURVEY

 External decorations	
Repair category:	2
Notes:	Decoration to the plywood wall cladding, and to timber trims around the windows, is weathered in places.
 Conservatories / porches	
Repair category:	N/A
Notes:	There are no conservatories or porches.
 Communal areas	
Repair category:	N/A
Notes:	There are no communal areas.
 Garages and permanent outbuildings	
Repair category:	N/A
Notes:	There are no garages or permanent outbuildings.
 Outside areas and boundaries	
Repair category:	3
Notes:	Cracking noted to the boundary walls, with extensive structural movement to the walls to the front garden, adjacent to a mature tree.
 Ceilings	
Repair category:	1
Notes:	No significant defects noted.
 Internal walls	
Repair category:	1
Notes:	No significant defects noted.
 Floors including sub-floors	
Repair category:	1
Notes:	No significant defects noted.

SINGLE SURVEY

	Internal joinery and kitchen fittings	
Repair category:	2	
Notes:	Hole in door to the ground floor Bedroom, from where a lock has been removed. Timber finishes are poorly fitting in places.	
	Chimney breasts and fireplaces	
Repair category:	1	
Notes:	No significant defects noted.	
	Internal decorations	
Repair category:	1	
Notes:	Edges of wallpaper are loose in places.	
	Cellars	
Repair category:	N/A	
Notes:	There are no cellars.	
	Electricity	
Repair category:	1	
Notes:	The electrical installation was not tested.	
	Gas	
Repair category:	N/A	
Notes:	There is no gas installation.	
	Water, plumbing and bathroom fittings	
Repair category:	1	
Notes:	The plumbing installation was not tested.	
	Heating and hot water	
Repair category:	1	
Notes:	The heating and hot water systems were not tested.	
	Drainage	
Repair category:	1	
Notes:	No access to inspect the underground drainage network.	

SINGLE SURVEY

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	1
External decorations	2
Conservatories / porches	N/A
Communal areas	N/A
Garages and permanent outbuildings	N/A
Outside areas and boundaries	3
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	N/A
Electricity	1
Gas	N/A
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Repair Categories

Category 3:

Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2:

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1:

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes: Parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground & First
2. Are there three steps or fewer to a main entrance door of the property?	Yes
3. Is there a lift to the main entrance door of the property?	No
4. Are all door openings greater than 750mm?	No
5. Is there a toilet on the same level as the living room and kitchen?	Yes
6. Is there a toilet on the same level as a bedroom?	Yes
7. Are all rooms on the same level with no internal steps or stairs?	No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Check

- Rights and responsibilities for mutual parts, boundaries etc.
- That the Title is clean and Heritable with no onerous burdens or conditions.

Estimated re-instatement cost for insurance purposes


£300,000 (Three Hundred Thousand Pounds).

Valuation and market comments

The market value of the property as described in this report is £210,000 (Two Hundred and Ten Thousand Pounds).

This figure assumes vacant possession and that the property is unaffected by adverse planning proposals, onerous burdens, title restrictions and servitude rights.

Signed

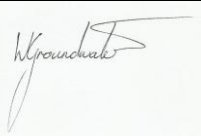

Surveyors Name

Billy Groundwater, AssocRICS

Company Name

Alfred Flett Ltd

Address:

St.Mary's, Holm, Orkney, KW17 2RU

Date of report:

23rd July 2026

Energy Performance Certificate (EPC)

Scotland

Dwellings

7 BROADSANDS ROAD, KIRKWALL, KW15 1BP

Dwelling type: Semi-detached house
Date of assessment: 13 July 2026
Date of certificate: 14 July 2026
Total floor area: 117 m²
Primary Energy Indicator: 241 kWh/m²/year

Reference number: 8116-7023-7100-0047-4296
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, oil


You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£5,778	See your recommendations report for more information
Over 3 years you could save*	£420	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

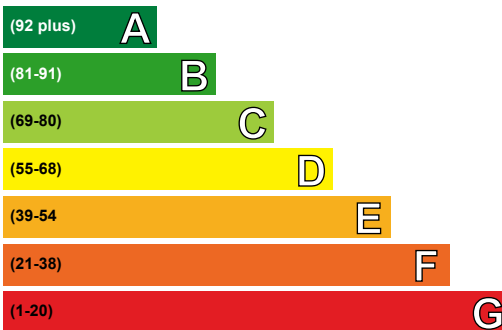

Not energy efficient - higher running costs

Current	Potential
61	69


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (61)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

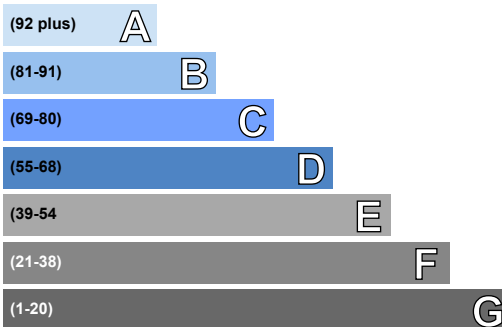

Not environmentally friendly - higher CO₂ emissions

Current	Potential
52	57

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (52)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (suspended floor)	£5,000 - £10,000	£342.00
2 Solar water heating	£4,000 - £7,000	£81.00
3 Solar photovoltaic (PV) panels	£8,000 - £10,000	£672.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction. See the addendum section on the last page of this report for further information relating to items in the table.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, partial insulation (assumed)	★★★★☆☆	★★★★☆☆
	Timber frame, as built, insulated (assumed)	★★★★★☆☆	★★★★★☆☆
Roof	Pitched, 300 mm loft insulation	★★★★★★★	★★★★★★★
	Flat, insulated	★★★★☆☆☆	★★★★☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
	Suspended, insulated (assumed)	—	—
Windows	Fully double glazed	★★★★☆☆☆	★★★★☆☆☆
Main heating	Boiler and radiators, oil	★★★★☆☆☆	★★★★☆☆☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★★☆☆	★★★★★☆☆
Secondary heating	Room heaters, coal	—	—
Hot water	From main system	★★★★☆☆☆	★★★★☆☆☆
Lighting	Good lighting efficiency	★★★★★☆☆	★★★★★☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 63 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 7.4 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.8 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.


Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£4,458 over 3 years	£4,137 over 3 years	
Hot water	£1,083 over 3 years	£984 over 3 years	
Lighting	£237 over 3 years	£237 over 3 years	
Totals	£5,778	£5,358	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

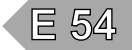Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Floor insulation (suspended floor)	£5,000 - £10,000	£114		
2 Solar water heating	£4,000 - £7,000	£27		
3 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£224		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

energy
saving
trust

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

3 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	15,132.58	N/A	N/A	N/A
Water heating (kWh per year)	2,885.43			

Addendum

When considering the PV installation consider installing PV battery and a PV diverter for water heating

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. William Groundwater
Assessor membership number:	EES/019552
Company name/trading name:	Alfred Flett Ltd
Address:	St. Mary's Holm Orkney KW17 2RU
Phone number:	01856 811765
Email address:	billy@orkneysurveying.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



property questionnaire

Property Address	7 Broadsands Road, Kirkwall, Orkney, KW15 1HN
Seller(s)	
Completion date of Property Questionnaire	13 July 2026

Note for sellers

- Please complete this form carefully. It is important your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell you solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of Ownership
	How long have you owned the property? November 2015
2.	Council Tax
	Which Council Tax band is your property in? ☐ A ☐ B ☒ C ☐ D ☐ E ☐ F ☐ G ☐ H
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply) Garage ☐ Allocated parking space ☐ Driveway ☒ On street ☐ Resident Permit ☐ Metered parking ☐ Shared parking ☐ Other (please specify)

property questionnaire

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	No
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations/Additions/Extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example provision of an extra bath/shower room, toilet or bedroom)? <u>If you have answered yes</u>, please describe below the changes which you have made: (ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? <u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them.	No Please select
b.	Have you had replacement windows, doors, patio doors or double-glazing installed in your property? If you have answered yes, please answer the three questions below: (i) Were the replacements the same shape and type as the ones you replaced? (ii) Did this work involve any changes to the window or door openings?	Yes No No

property questionnaire

	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): New double glazed kitchen window, same shape and opening - Dec 2024 New composite back door - December 2024 New double glazed living room window, same shape, reduced from two to one opening - August 2025. Previous window was single glazed New composite front door - August 2025.	
7.	Central heating Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). If you have answered yes or partial – what kind of central heating is there? Oil (examples: gas-fired, solid fuel, electric storage heating, gas-warm air). If you have answered yes, please answer the three questions below:	Yes
	(i) When was your central heating system or partial central heating system installed? New Grant Vortex external boiler and oil tank - February 2020 3 new radiators fitted in bedrooms upstairs - February 2020. Previously had no bedroom radiators. Boiler last serviced July 2024 (ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract: (iii) When was your maintenance agreement last renewed? (Please provide the month and year).	No
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate, which is less than 10 years old?	Yes

9.	Issues that may have affected your property																									
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it? <u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?	No Please select																								
b.	Are you aware of the existence of asbestos in your property? <u>If you have answered yes</u>, please give details:	No																								
10.	Services																									
a.	Please tick which services are connected to your property and give details of the supplier: <table border="0" style="width: 100%;"> <thead> <tr> <th style="text-align: left;">Services</th> <th style="text-align: center;">Connected</th> <th style="text-align: left;">Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td> <td style="text-align: center;">☐</td> <td> </td> </tr> <tr> <td>Water mains or private water supply</td> <td style="text-align: center;">☒</td> <td> Scottish Water </td> </tr> <tr> <td>Electricity</td> <td style="text-align: center;">☒</td> <td> Ovo Energy </td> </tr> <tr> <td>Mains drainage</td> <td style="text-align: center;">☒</td> <td> Scottish Water </td> </tr> <tr> <td>Telephone</td> <td style="text-align: center;">☐</td> <td> </td> </tr> <tr> <td>Cable TV or satellite</td> <td style="text-align: center;">☐</td> <td> </td> </tr> <tr> <td>Broadband</td> <td style="text-align: center;">☐</td> <td> </td> </tr> </tbody> </table>		Services	Connected	Supplier	Gas or liquid petroleum gas	☐		Water mains or private water supply	☒	Scottish Water	Electricity	☒	Ovo Energy	Mains drainage	☒	Scottish Water	Telephone	☐		Cable TV or satellite	☐		Broadband	☐	
Services	Connected	Supplier																								
Gas or liquid petroleum gas	☐																									
Water mains or private water supply	☒	Scottish Water																								
Electricity	☒	Ovo Energy																								
Mains drainage	☒	Scottish Water																								
Telephone	☐																									
Cable TV or satellite	☐																									
Broadband	☐																									

property questionnaire

b. Is there a septic tank system at your property? <u>If you have answered yes</u>, please answer the two questions below: (i) Do you have appropriate consents for the discharge from your septic tank? (ii) Do you have a maintenance contract for your septic tank? <u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:	No Please select Please select
---	--

property questionnaire

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? <u>If you have answered yes, please give details:</u>	No
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? <u>If you have answered yes, please give details:</u>	No
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	No
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries? <u>If you have answered yes, please give details:</u>	No
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? <u>If you have answered yes, please give details:</u>	No

property questionnaire

f.	As far as you are aware, is there a public right of way across any part of your property (public right of way is a way over privately-owned)? <u>If you have answered yes</u>, please give details:	No
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property? <u>If you have answered yes</u>, please provide the name and address, and give details of any deposit held and approximate charges:	No
b.	Is there a common buildings insurance policy? <u>If you have answered yes</u>, is the cost of the insurance included in your monthly/annual factor's charges?	No Please select
c.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	

property questionnaire

13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	No
b.	As far as you were aware, has any preventative work for dry rot, wet rot, or damp, ever been carried out to your property? <u>If you have answered yes</u>, please give details:	No
c.	<u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work? <u>If you have answered yes</u> these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	Please select

property questionnaire

14.	Guarantees	
a.	Are there any guarantees or warranties for any of the following: (i) Electrical work (ii) Roofing (iii) Central heating (iv) National House Building Council (NHBC) (v) Damp course (vi) Any other work or installations (for example, cavity wall insulation, underpinning, indemnity policy)	Please select Please select Please select Please select Please select Please select
b.	If you have answered yes or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c.	Are there any outstanding claims under any of the guarantees listed above? <u>If you have answered yes</u>, please give details:	No
15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years? <u>If you have answered yes</u>, please give details:	No

property questionnaire

16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	No
b.	that affects your property in some other way?	No
c.	that requires you to do any maintenance, repairs or improvements to your property?	No
<u>If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</u>		

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):

Date:

13/7/2026

PART 1 – GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☐

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The/-

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 INTELLECTUAL PROPERTY

Any intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.5 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.6 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection. /-

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.7 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.8 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Market Value" is *The estimated amount for which a Property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member of partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyors opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: /-

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable. Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

Market Value" The estimated amount for which a property should exchange on the date of valuation within a willing buyer and a willing seller in an arms-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" /-

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.